


DESCRIPTION	DATE
Fuses	Nov. 21, 2016

Identification: CV 087, Section A-70

INFRARED IMAGE

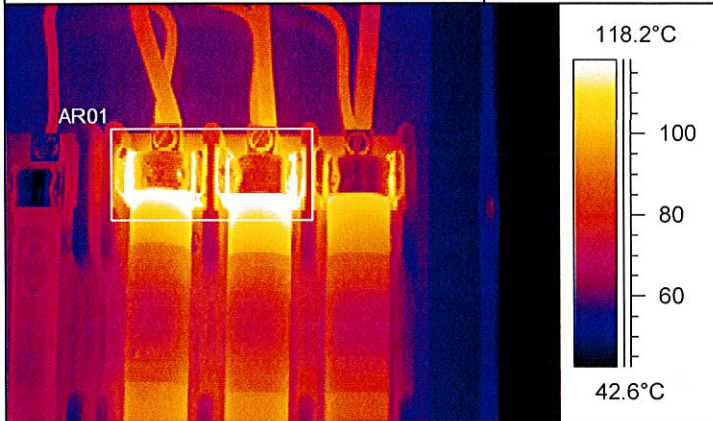

PHOTO



IR information	Value
Date of creation	11-21-2001
Object parameter	Value
Ambient temperature	22.0°C
Label	Value
AR01 : max	146.6°C

Current Measured at Time of Inspection
Not Available

DESCRIPTION:

An InfraRed image of fuses located inside the CV 087 panel; identified as the main fuses. Heating was noted on the top-middle/ left fuse clip connections (red arrow in photo). See IR information chart above for maximum temperature inside area box. *An Immediate Action Report was issued for this anomaly at the time of the inspection.*

Priority: CV 087, Section A-70

RECOMMENDATION:	1	2	3	4		
	No Action Low			High Don't Run		

Check the connection components for heat damage. Replace if required.
Clean the fuse and fuse clips. Ensure the fuse clip tightness as per the manufacturer's specifications.
Re-inspect the unit after the repairs are completed.